

DPD 5147-59
4 August 1959

MEMORANDUM FOR: Chief, Materiel Branch, DPD-DD/P

SUBJECT : Malfunction Report for July 1959

1. Detachment "B" reported the following malfunctions:

A. Mission 4125. Tube V-9 in HRB preamplifier failed.

B. Mission 4131. A blown fuse in bias supply of [] prevented automatic turn-on. Later tests failed to discover the cause of the blown fuse. 25X1

C. Mission 4133. Also blown fuse in bias supply of [] A current measurement of the supply was made which indicated the need for a fuse of increased current rating. The fuse rating was increased from .1 amp to .2 amps. 25X1

D. Mission 4132. The number three receiver of [] suffered a sensitivity reduction from 97 dbm to 54 dbm due to a defective solder connection on the filament line of the multicoupler strip. 25X1

E. Mission 1519. [] recorder capstan motor ran slow during the latter portion of the mission. Undergoing investigation to determine the cause. 25X1

2. [] submitted a negative report for this period.

SIGNED

[]
Chief, Communications Section
DPD-DD/P 25X1

Distribution:

Orig & 1 - Addressee

1 - O-15

1 - RI

1 - Chrono

WWB/ba

SECRET